



KÖSTER Joint Tape 20


Technical Data Sheet J 820 020

Issued: 2016-03-02

Elastic sealing tape for waterproofing joints and irregular cracks

Features

KÖSTER Joint Tape 20 is a thermoplastic tape for sealing expansion and dilatation joints and irregular cracks. KÖSTER Joint Tape 20 is UV resistant, highly elastic and can withstand extreme movements. The Joint Tape System consists of the KÖSTER Joint Tape 20 and KÖSTER KB-Pox Adhesive, (a 2 component epoxy based, thixotropic high performance adhesive) which are applied as a system.

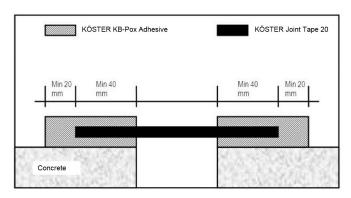

Technical Data

i Ecililicai Dala	
Width	20 cm
Color Elongation at break EN ISO	RAL 7045 grey > 400 %
527-3	> 400 / ₆ _
Tear growth resistance EN	> 600 N / cm
12310-2	
Tear resistance lengthwise EN	> 9 MPa
ISO 527-3	
Tear resistance crosswise EN	> 6 MPa
ISO 527-3	
Resistance to cold / heat SIA	- 30 °C to +80 °C
280/3	
Hardness (Shore A) ISO 868	80
Resistance to bitumen DIN	Resistant
16726	
Peel of strength	> 20 N / 10 mm
Resistance to water pressure EN	> 8.0 bar
1928	
Resistance to UV radiation SIA	> 7500 hours
V280/10	
Chemical resistance	Water and bitumen based
	waterproofing products water Sea

water and blumen based waterproofing products, water, Sea water, waste water, UV radiation, hydrolysis, micro-organisms pH = 2 to 10 (below + 30 °C) pH = 5 to 10 (below + 40 °C)

pH = 5 to 10 (below + 40 °C)pH = 6 to 8 (below + 60 °C)

Acids and alkalis, organic solvents such as Esters and Ketons

Fields of Application

Limited resistance to

pH resistance

- Waterproofing horizontal and vertical dilatation joints
- Waterproofing wide and irregular cracks
- Connection joints of slabs and walls
- Suitable substrates are concrete, mortar, wood, metal, steel, aluminium, glass fiber reinforced plastics, epoxy mortar, natural and artificial stone, and many other building materials.

Typical uses

- Terraces and balconies
- Facades
- Wet rooms
- Foundations and curtain walls
- Concrete pipes
- Water basins
- Swimming pools
- Dilatation joints
- Tunnels
- Park houses
- Power plants
- Wastewater tanks, waste water treatment plants, etc.

Substrate

Surfaces must be clean, dry,sound ,and solid. On damp surfaces the pull off strength should be tested. Dust, oil, grease, old coatings,laitance, efflorescence, rust, curing compounds, wax, formwork release agents, and similar contaminants must be removed prior to application. Concrete surfaces: If necessary, the substrate has to be sanded, ground, or shot blasted to guarantee an optimal adhesion of KÖSTER KB-Pox Adhesive. Metal surfaces: Must be cleaned to SA 2 ½ standard

Application

 $\dot{\text{KOSTER}}$ Joint Tape 20 can be welded with a hot air welding machine set to + 270 °C. The maximum temperature allowed for welding is + 300 °C. Welding of the tape should be carried out prior to the application. Before welding the tape, roughen the seam area with a wire brush or a scotch brite. To weld the tape, place it on a level substrate and heat the overlapping ends with a hot air gun. Press the ends of the tape together firmly using the KÖSTER Rubber Hand Roller. In this way lengths greater than 20 m (the length of 1 roll) can easily be made on site.

- 1. KÖSTER KB-Pox Adhesive is applied to the prepared substrate on both sides of the joint so that both sides of the KÖSTER Joint Tape 20 are embedded into the adhesive at least 40 mm. The layer thickness of the KÖSTER KB-Pox Adhesive should be approx. 1 - 2 mm.
- 2. The KÖSTER Joint Tape 20 is then immediately embedded into the fresh adhesive and pressed into the adhesive using a hand roller or a similar suited tool. Make sure that the tape has complete contact to the adhesive.
- 3. A second layer of KÖSTER KB-Pox Adhesive is then applied on top of the KÖSTER Joint Tape 20 so that the edges of the KÖSTER Joint Tape 20 are over-coated at least 40 mm. Also

The information contained in this technical data sheet is based on the results of our research and on our practical experience in the field. All given test data are average values which have been obtained under defined conditions. The proper and thereby effective and successful application of our products is not subject to our control. The installer is responsible for the correct application under consideration of the specific conditions of the construction site and for the final results of the construction process. This may require adjustments to the recommendations given here for standard cases. Specifications made by our employees representatives which exceed the specifications contained in this technical guideline require written confirmation. The valid standards for testing and installation, technical guidelines, and acknowledged rules of technology have to be adhered to at all times. The warranty can and is therefore only applied to the quality of our products within the scope of our terms and conditions, not however, for their effective and successful application. This guideline has been technically revised; all previous versions are invalid.

KÖSTER BAUCHEMIE AG • Dieselstraße 1-10 • D-26607 Aurich • Tel. 04941/9709-0 • Fax -40 • info@koester.eu • www.koester.eu

KÖSTER Joint Tape 20 1/2



apply KÖSTER KB-Pox Adhesive so that it covers the substrate next to the tape at least 20 mm.

Do not stress the system for at least 48 hours after application. Protect the freshly applied system from water, rain and frost until it has fully cured.

Consumption

Approx. 1 kg of KÖSTER KB-Pox Adhesive per meter KÖSTER Joint Tape 20

Cleaning

Fresh epoxy adhesive can be removed with KÖSTER Universal Cleaner. Cured material must be mechanically removed.

Packaging

J 820 020 d:1mm, b:200mm, l:20m / 20 m roll

Storage

Store the material in a cool and dry place. In originally sealed packages it can be stored for a minimum of 24 months.

Other

- Do not apply below +5 $\,^{\circ}\text{C}$ or if temperatures below +5 $\,^{\circ}\text{C}$ are expected within the next 24 hours
- Do not apply the system on wet or frozen surfaces
- Do not apply the system on sanding or weak surfaces. If in doubt, test the pull off strength
- Cold temperatures prolong and warm temperatures shorten the pot life and curing time of the epoxy adhesive
- High levels of humidity may prevent proper curing of the epoxy adhesive
- For application of the system as part of a negative side waterproofing, please contact our Technical Service
- In areas which are stressed by traffic, the system should be mechanically protected from damage with protective metal plates

Related products

KÖSTER KB-Pox Adhesive Prod. code J 120 005

KÖSTER Joint Tape 30 Prod. code J 830 020

KÖSTER Universal Cleaner Prod. code X 910 010

KÖSTER Spatula Prod. code X 987 001

The information contained in this technical data sheet is based on the results of our research and on our practical experience in the field. All given test data are average values which have been obtained under defined conditions. The proper and thereby effective and successful application of our products is not subject to our control. The installer is responsible for the correct application under consideration of the specific conditions of the construction site and for the final results of the construction process. This may require adjustments to the recommendations given here for standard cases. Specifications made by our employees or representatives which exceed the specifications contained in this technical guideline require written confirmation. The valid standards for testing and installation, technical guidelines, and acknowledged rules of technology have to be adhered to at all times. The warranty can and is therefore only applied to the quality of our products within the scope of our terms and conditions, not however, for their effective and successful application. This guideline has been technically revised; all previous versions are invalid.

KÖSTER BAUCHEMIE AG • Dieselstraße 1-10 • D-26607 Aurich • Tel. 04941/9709-0 • Fax -40 • info@koester.eu • www.koester.eu

KÖSTER Joint Tape 20 2/2